

William Klosowski

Ok.

Feb 2, 2021, 2:49 AM

Bryan Fields

And this is why I don't sell radios on ebay

Feb 2, 2021, 2:48 AM

William Klosowski

Its getting fixed anyways...but I think my Harris got fixed another way then replacing the board.


Feb 2, 2021, 2:45 AM

William Klosowski

Dude just shut the fuck up about it.

Feb 2, 2021, 2:43 AM

Bryan Fields

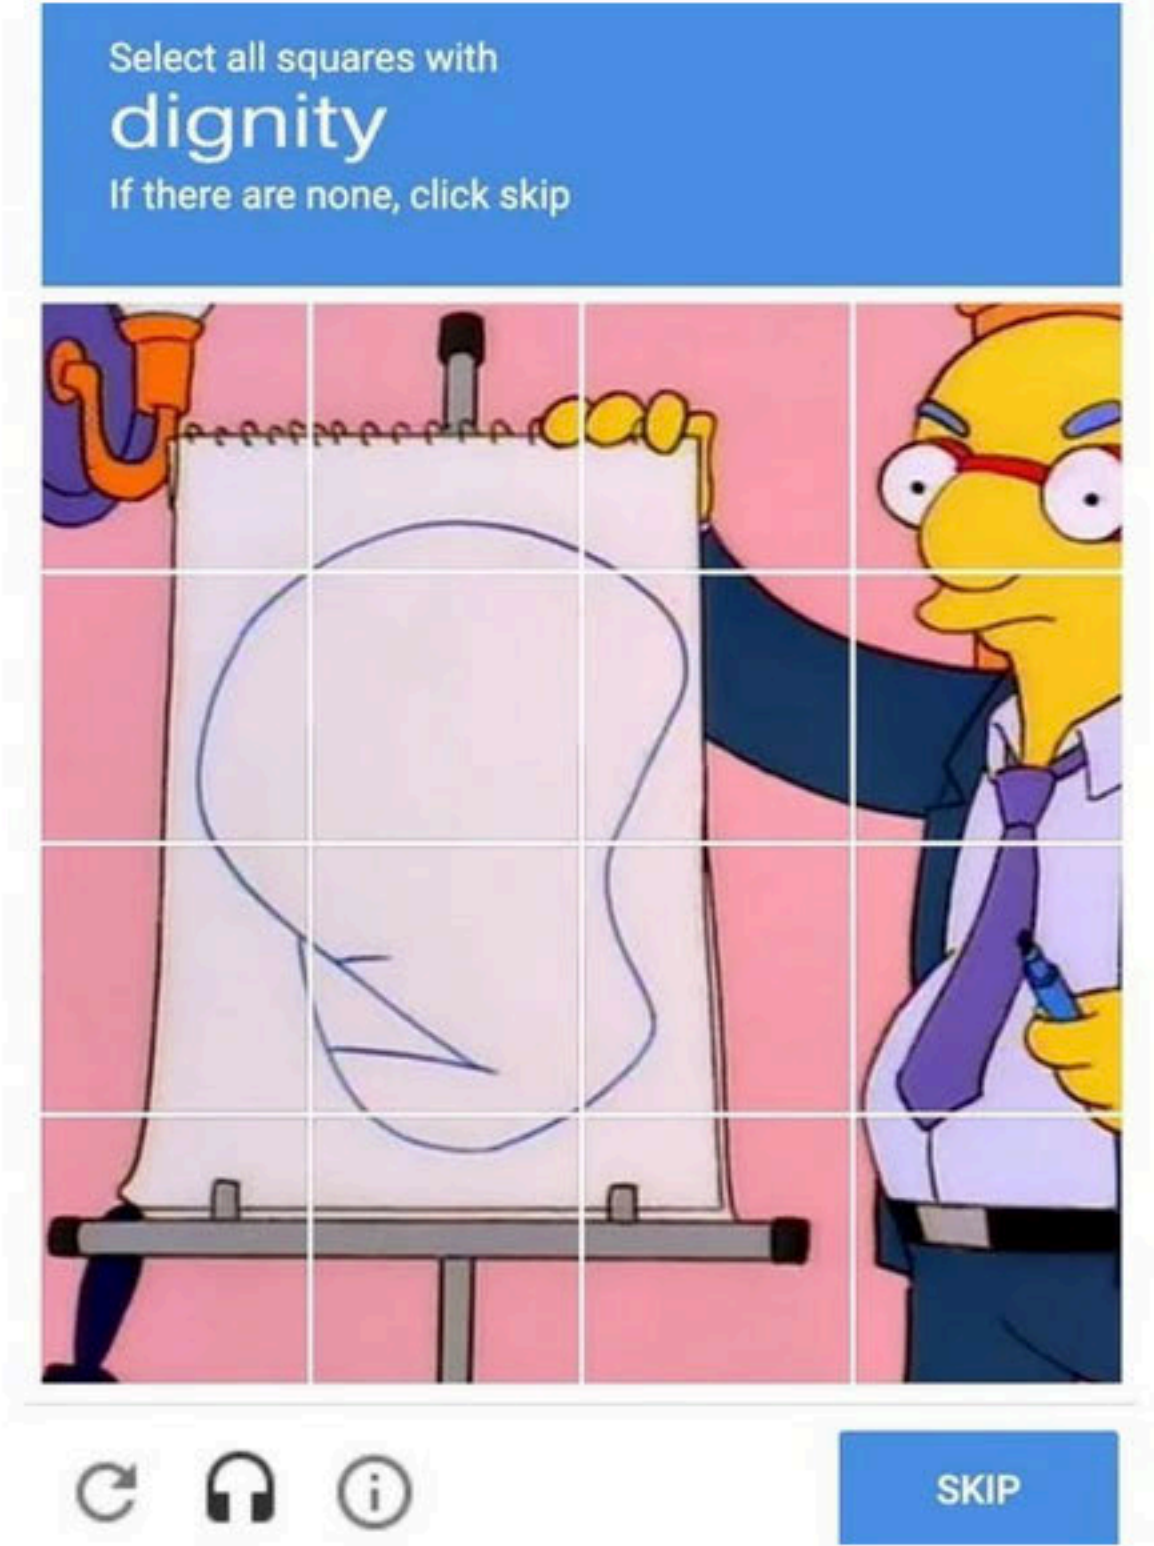

Feb 2, 2021, 2:42 AM

William Klosowski

Nope it in transit to the seller

Feb 2, 2021, 2:42 AM

Bryan Fields

How about that CDM?

Feb 1, 2021, 11:13 PM

William Klosowski

Works fine now.


Feb 1, 2021, 9:36 PM

William Klosowski

Didnt change a board..debricked it

Feb 1, 2021, 8:39 PM



 L3HARRIS™	<i>Prepared By</i>	<i>Docoument Number</i>
	T. HOWELL	DCRRS002-c02
	<i>Date</i>	<i>Revision</i>
Template #: DCRRS002-c02 Date: July 24, 2019 Tempate Revision: A	July 24, 2019	B

<i>Date</i>	<i>Repair Order-Line#</i>	<i>Model#</i>	<i>Serial #</i>
19-Jan-21	70117972-010	DPXG-PF78B	A4014B001987

<i>Condition</i>	<i>Exc</i>	<i>Good</i>	<i>Fair</i>	<i>Poor</i>
	N	Y	N	N

<i>Phys.Damage</i>
N

<i>Damage Notes</i>

<i>Aligned</i>	<i>Tested</i>
Y	Y

<i>Problems</i>
Displays Hardware Error

<i>Other Problems</i>

<i>Repair Notes</i>
Initially radio was bricked b/c of wrong firmware installed, DeBricked radio and loaded firmware R06E06, Fully tested.

Measurements

<i>Power Out</i>	<i>TX Current</i>	<i>Immersion Test</i>
3.10W	1.55A	N
<i>Freq. Deviation</i>	<i>Stnby Cur</i>	<i>Immersion Pass</i>
10Hz	.13A	N
<i>Voice Deviation</i>	<i>12 Db Sinad</i>	<i>Radio Cleaned</i>
4.47kHz	-121.5dBm	Y
<i>Crit Squelch</i>		<i>Radio Software IN</i>
-125.2dBm		R02A26

<i>Radio Software OUT</i>
R06E06

<i>Initials</i>
MTY

Additional Comments

N/A

Bryan Fields

I was a participant in it; you want to talk pain, lol

Feb 1, 2021, 12:12 AM

Ryan Owens

That was an extremely painful conversation to catch up on.

😬 Austin Read

Feb 1, 2021, 12:04 AM

William Klosowski

I'm knowledgeable with alot of radios but appears this one wasnt.

Jan 31, 2021, 11:44 AM

Bryan Fields

it's only fair techs should do the same

Jan 31, 2021, 11:43 AM

Bryan Fields

i mean, sex offenders have to let people know that before they watch their kids

Jan 31, 2021, 11:42 AM

William Klosowski

This was a radio I wasnt familiar with..as I said..

Jan 31, 2021, 11:42 AM

William Klosowski

You can stay in your lane.

Jan 31, 2021, 11:42 AM

William Klosowski

Wasnt my choice to ship it back...but I have already talked to the buyer and seller and agreed to send it back.

Jan 31, 2021, 11:42 AM

Bryan Fields

you need to inform people you're not competent and cannot follow instructions before working on their radios.

Jan 31, 2021, 11:41 AM

William Klosowski

So it's being sent back to the buyer and he will get it back working as he is a radio shop and and has the ability to fix it

Jan 31, 2021, 11:41 AM

William Klosowski

I dont need you harping on me when it's nothing to do with you..again I appreciate your help but the issue has been handled

Jan 31, 2021, 11:40 AM

William Klosowski

No I went to write the passport plug and it stopped in the middle...cheap cable..and no dont worry about it..has been handled..

Jan 31, 2021, 11:39 AM

Bryan Fields

they came to you for help and you bricked their radio?

Jan 31, 2021, 11:38 AM

Bryan Fields

like you were not the buyer or seller here?

Jan 31, 2021, 11:38 AM

Bryan Fields

you did this to an innocent person's radio

Jan 31, 2021, 11:38 AM

Bryan Fields

hold up

Jan 31, 2021, 11:38 AM

William Klosowski

It's in the seller's and buyers hands now..not my problem anymore..and hes aware of the issue and will fix it.

Jan 31, 2021, 11:36 AM

Bryan Fields

lol, your seller is going to be pissed

Jan 31, 2021, 11:35 AM

William Klosowski

So you can drop it and thank you for your assistance.

Jan 31, 2021, 11:35 AM

William Klosowski

Oh well wasnt my choice.

Jan 31, 2021, 11:32 AM

Bryan Fields

That's unethical

Jan 31, 2021, 11:25 AM

William Klosowski

Yeah sending it back to the seller.

Jan 31, 2021, 11:25 AM

Bryan Fields

still broken?

Jan 31, 2021, 11:24 AM

Bryan Fields

trumplug



😬 Austin Read

Jan 30, 2021, 1:51 PM

William Klosowski

Damnit

Jan 30, 2021, 1:50 PM

Bryan Fields

there's a plug for you



DHGate.com dgw168

Jan 30, 2021, 1:50 PM

William Klosowski

I got it out of your folder of plugs

Jan 30, 2021, 1:49 PM

Bryan Fields

<https://i.imgur.com/zJqx7cY.gif>

Jan 30, 2021, 1:48 PM

Bryan Fields

will, what is the fucking name of the damn file you are using as a default codeplug

Jan 30, 2021, 1:48 PM

William Klosowski

And it didnt work..

Jan 30, 2021, 1:47 PM

Bryan Fields

so I think it's beyond you

Jan 30, 2021, 1:47 PM

William Klosowski

That what I did...

Jan 30, 2021, 1:47 PM

Bryan Fields

but you can't even tell me the file name of the default code plug you're using

Jan 30, 2021, 1:47 PM

Bryan Fields

there is, it's called load a default codeplug and tune it

Jan 30, 2021, 1:46 PM

William Klosowski

Now there has to be another way.

Jan 30, 2021, 1:36 PM

Bryan Fields

you're fucked

Jan 30, 2021, 1:36 PM

Bryan Fields

you cannot tell me the damn file name of the default code plug you're using

Jan 30, 2021, 1:36 PM

Bryan Fields

you don't have a backup, you're fucked

Jan 30, 2021, 1:36 PM

William Klosowski

Ok now can you please help me get back this to working order and I can get it tuned.

Jan 30, 2021, 1:35 PM

Bryan Fields

no you have not

Jan 30, 2021, 1:35 PM

William Klosowski

Yes seems like it..I did what you said.

Jan 30, 2021, 1:34 PM

Bryan Fields

you're unable to follow simple requests, I think this is squarely out of your wheelhouse.

Jan 30, 2021, 1:34 PM

William Klosowski

No I need it fixed or back to working state

Jan 30, 2021, 1:33 PM

Bryan Fields

25 dollars is my offer for the radio

Jan 30, 2021, 1:33 PM

Bryan Fields

ok, fuck it

Jan 30, 2021, 1:32 PM

William Klosowski

Yeah well I loaded the default still stuck

Jan 30, 2021, 1:32 PM

Bryan Fields

this is some autistic shit man

😏 Ryan Øwens

Jan 30, 2021, 1:32 PM

Bryan Fields

again, I ask, what is the file name of the default codeplug you're using?

Jan 30, 2021, 1:31 PM

William Klosowski

With the default?

Jan 30, 2021, 1:31 PM

Bryan Fields

cp tool will automatically set then when you load it

Jan 30, 2021, 1:31 PM

William Klosowski

What is it? I just need to get it back to normal state.

Jan 30, 2021, 1:30 PM

Bryan Fields

the end of the default codeplug is not 3fff

Jan 30, 2021, 1:30 PM

Bryan Fields

you're fucked

Jan 30, 2021, 1:30 PM

Bryan Fields

well if you didn't read it from the radio and save it and then wrote a default over the radio

Jan 30, 2021, 1:30 PM

William Klosowski

Its slow on writing the default plug....damn..

Jan 30, 2021, 1:29 PM

William Klosowski

So I'm screwed on that let's fix it the other way.

Jan 30, 2021, 1:28 PM

William Klosowski

Ppl

Jan 30, 2021, 1:28 PM

William Klosowski

End is 3FFF

Jan 30, 2021, 1:27 PM

William Klosowski

Appears it wasnt extracted over...so let's start from scratch

Jan 30, 2021, 1:27 PM

Bryan Fields

where is cp tool installed?

Jan 30, 2021, 1:23 PM

William Klosowski

Yeah I'm not sure where it went

Jan 30, 2021, 1:23 PM

Bryan Fields

write it from 0 to the end

Jan 30, 2021, 1:23 PM

Bryan Fields

but I said that's your backup

Jan 30, 2021, 1:22 PM

William Klosowski

Ok now how to I do that? Take awhile to write..











Jan 30, 2021, 1:22 PM

Bryan Fields

its noramlly in that ReadData directory

Jan 30, 2021, 1:22 PM

Bryan Fields

name	Date modified	Type
 ReadData	10/8/2020 3:04 PM	File folder
 ._DS_Store	10/23/2020 9:09 PM	DS_STORE
 .DS_Store	10/27/2020 2:54 AM	DS_STORE
 borIndmm.dll	2/1/2002 8:00 AM	Application
 cc3260mt.dll	1/30/2003 7:04 AM	Application
 rtl60.bpl	2/1/2002 1:11 PM	BPL File
 NTS RWCodeplug(de).exe	1/11/2009 1:13 AM	Application
 NTS RWCodeplug(en).exe	1/11/2009 1:13 AM	Application
 Softtool manual.doc	1/9/2009 9:17 PM	DOC File
 vd60.bpl	11/23/2007 4:21 PM	BPL File

Jan 30, 2021, 1:22 PM

Bryan Fields

it doesn't just disappear

Jan 30, 2021, 1:21 PM

Bryan Fields

you will need to load the entire default code plug and then tune it from scratch


Jan 30, 2021, 1:21 PM

William Klosowski

Yeah it did save it and it disappeared

Jan 30, 2021, 1:21 PM

Bryan Fields



William

Ok read and saved



William

Ok

ok, that's your backup

Jan 30, 2021, 1:20 PM

William Klosowski

No way to depot it and bring it back?

Jan 30, 2021, 1:20 PM

Bryan Fields

well then you're fucked

Jan 30, 2021, 1:20 PM

William Klosowski

Its fucking gone...fuck.

Jan 30, 2021, 1:19 PM

Bryan Fields

should be in the read dir under the directory of cp tool

Jan 30, 2021, 1:17 PM

William Klosowski

I dont know where it went I'll have to find it

Jan 30, 2021, 1:16 PM

Bryan Fields

did you not make a copy of it?

Jan 30, 2021, 1:16 PM

Bryan Fields

did you not save the file?

Jan 30, 2021, 1:16 PM

Bryan Fields

you said you had saved the backup

Jan 30, 2021, 1:16 PM

William Klosowski

I dont I can recover it because I lost the saved plug the hell did it go..

Jan 30, 2021, 1:14 PM

Bryan Fields

you had to load it in the cp tool before you wrote it to the radio

Jan 30, 2021, 1:13 PM

Bryan Fields

it's a simple question

Jan 30, 2021, 1:13 PM

William Klosowski

Not sure..but I think its done..fuck fuck

Jan 30, 2021, 1:12 PM

Bryan Fields

what is the file name?

Jan 30, 2021, 1:09 PM

William Klosowski

PMUE1755B M25SHF9DP5A

Jan 30, 2021, 1:08 PM

Bryan Fields

what is the file name of the default code plug you're using?

Jan 30, 2021, 1:07 PM

William Klosowski

Ok

Jan 30, 2021, 1:07 PM

Bryan Fields

then take the default code plug and write it in from 280

Jan 30, 2021, 1:07 PM

Bryan Fields

take the backup you made and write it from 0 to 27F to fix that

Jan 30, 2021, 1:07 PM

Bryan Fields

well if you wrote it from 190, it fucked the tuning

Jan 30, 2021, 1:06 PM

William Klosowski

Ugh this is already pissing me off.

Jan 30, 2021, 1:06 PM

William Klosowski

The fuck..

Jan 30, 2021, 1:05 PM

William Klosowski

I put in 280 and it defaulted back to 190 and 3FFF

Jan 30, 2021, 1:05 PM

William Klosowski

Yeah I think..

Jan 30, 2021, 1:04 PM

Bryan Fields

well did you write the default code plug from 280?

Jan 30, 2021, 1:00 PM

William Klosowski



Jan 30, 2021, 12:59 PM

William Klosowski

Yeah write it and and popped HW Error...really?

Jan 30, 2021, 12:59 PM

Bryan Fields

find the default one

Jan 30, 2021, 12:38 PM

Bryan Fields

you will have the tanpa, use that to cross reference it

Jan 30, 2021, 12:37 PM

William Klosowski

Thanks for the document

Jan 30, 2021, 12:37 PM

Bryan Fields

esr's definitive doc on it

Jan 30, 2021, 12:35 PM

Bryan Fields

<http://www.catb.org/esr/faqs/smart-questions.html>

Jan 30, 2021, 12:35 PM

William Klosowski

Oh ok

Jan 30, 2021, 12:35 PM

Bryan Fields

will, I'm not mad about you asking questions, I'm irritated when people ask questions they can answer for themselves by reading docs I've written

Jan 30, 2021, 12:35 PM

William Klosowski

I'm sorry if I'm asking alot of questions just never messed with one of these radios.

Jan 30, 2021, 12:33 PM

Bryan Fields

you could do that before hand, but that's way to hard to have you use a hexeditor

Jan 30, 2021, 12:32 PM

Bryan Fields

once you load it, you'll have to edit your serial number and the region code

Jan 30, 2021, 12:32 PM

Bryan Fields

Waris-Binary-Codeplugs.tar.bz2 - all the **Waris** default codeplugs from the upgrade kits converted to binary. You can open it CPS using the bin2srec converter after changing the region to 0x01 and recomputing the checksum. This is all kinds of useful.

Jan 30, 2021, 12:31 PM

Bryan Fields

srsly

Jan 30, 2021, 12:31 PM

Bryan Fields

it's on my wiki

Jan 30, 2021, 12:31 PM

Bryan Fields

why not?

Jan 30, 2021, 12:31 PM

William Klosowski

How I get that?

Jan 30, 2021, 12:31 PM

William Klosowski

No

Jan 30, 2021, 12:30 PM

Bryan Fields

you have the default codeplug loaded?

Jan 30, 2021, 12:29 PM

Bryan Fields

sure

Jan 30, 2021, 12:29 PM

William Klosowski

So what I stated now hit Write

Jan 30, 2021, 12:29 PM

Bryan Fields

well no, it will find the stop based on the file size when you load the default code plug

Jan 30, 2021, 12:28 PM

William Klosowski

Damn

Jan 30, 2021, 12:28 PM

Bryan Fields

since if you fuck with 0-280 you will over write the tuning data

Jan 30, 2021, 12:27 PM

William Klosowski

Start H00000280 and Stop h00003FFF

Jan 30, 2021, 12:27 PM

Bryan Fields

is*

Jan 30, 2021, 12:27 PM

Bryan Fields

but when you load it, you only want to load it from 280 to what ever the stop address it

Jan 30, 2021, 12:27 PM

Bryan Fields

now try to load the default codeplug on it for your radio

Jan 30, 2021, 12:26 PM

William Klosowski

Ok

Jan 30, 2021, 12:26 PM

Bryan Fields

ok, that's your backup

Jan 30, 2021, 12:26 PM

William Klosowski

Ok read and saved

Jan 30, 2021, 12:25 PM

Bryan Fields

ok, read the entire fucking thing and save it

Jan 30, 2021, 12:25 PM

William Klosowski

I'm used to newer radios

Jan 30, 2021, 12:25 PM

Bryan Fields

he rotates the phone again
😏 Alex Elmi

Jan 30, 2021, 12:24 PM

Bryan Fields

just when I through will was able to learn

Jan 30, 2021, 12:24 PM

C, QCII, DTMF) for trunking and con
channels

th FDB blocks are 5A. You will need t

NTS SYS Codeplug Tool for Waris Radios

Read Radio

COM1

Start Address

h000000000

Stop Address

h0000003FFF

Save File

Read File

M25SHF9DP5A

001TEE0440

Bryan Fields

goddamn

Jan 30, 2021, 12:23 PM

Bryan Fields

STOP = 3FFF

Jan 30, 2021, 12:23 PM

Bryan Fields

START = 0


Jan 30, 2021, 12:23 PM

Bryan Fields

read from 0 to 3FFF

Jan 30, 2021, 12:23 PM

William Klosowski

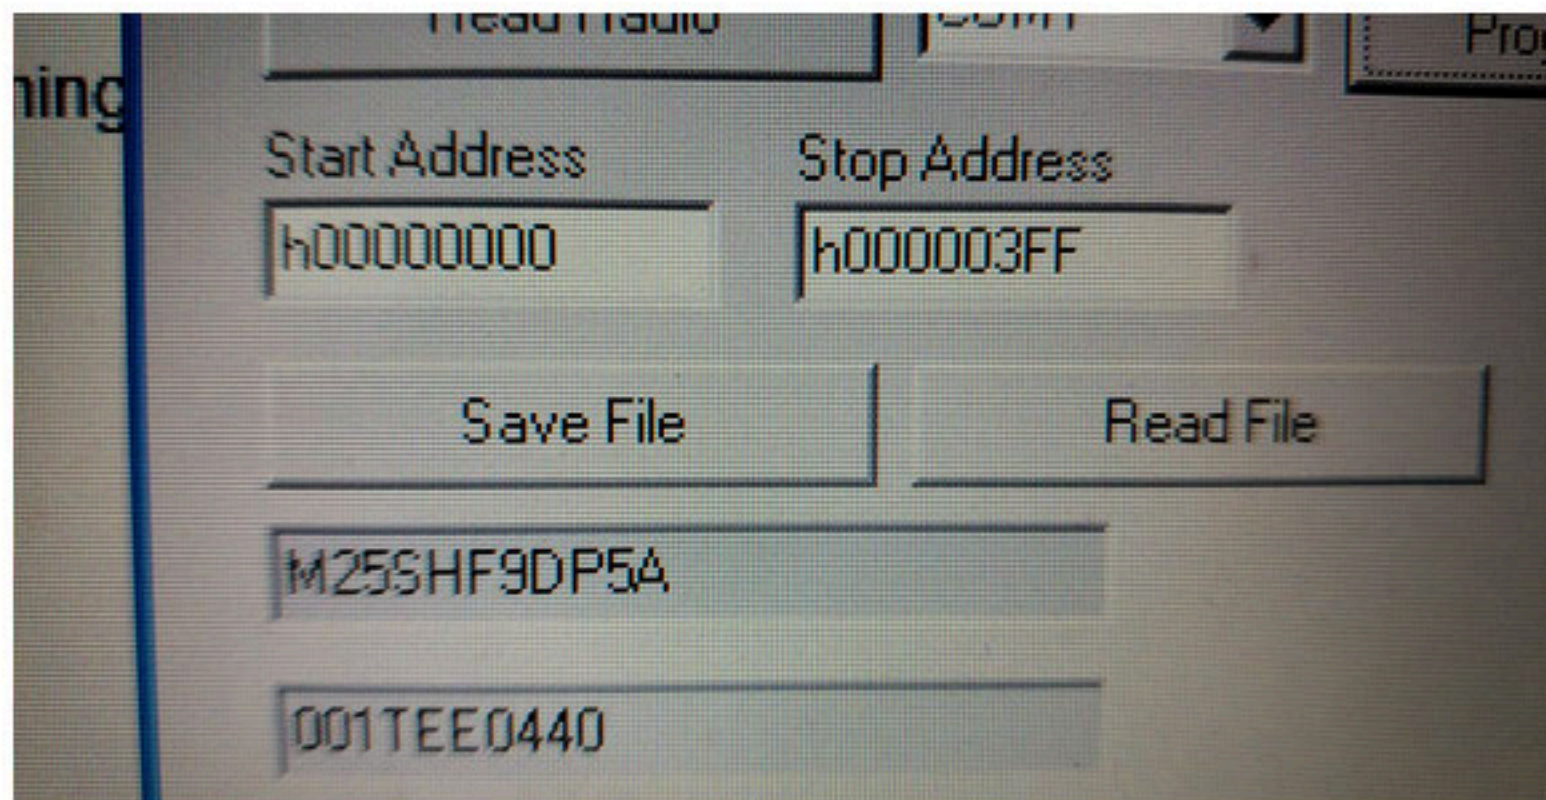

Jan 30, 2021, 12:22 PM

Bryan Fields

1024 is not 16384

Jan 30, 2021, 12:22 PM

Bryan Fields

not 03FF

Jan 30, 2021, 12:22 PM

Bryan Fields

0-3FFF

Jan 30, 2021, 12:21 PM

Bryan Fields

well considering you didn't save the entire codeplug, you're fucked

Jan 30, 2021, 12:21 PM

William Klosowski

Ok got it saved so what do I change the hex to?

Jan 30, 2021, 12:21 PM

Bryan Fields

<https://www.youtube.com/watch?v=C6YfJZ9hxLQ>

😄 Ryan Øwens

Jan 30, 2021, 12:20 PM

William Klosowski

Ok saved

Jan 30, 2021, 12:20 PM

William Klosowski

Yes

Jan 30, 2021, 12:20 PM

Bryan Fields

is 03FF the same as 3FFF?

Jan 30, 2021, 12:20 PM

Bryan Fields

so save it

Jan 30, 2021, 12:19 PM

William Klosowski

03FF

Jan 30, 2021, 12:19 PM

Bryan Fields

ok?

Jan 30, 2021, 12:19 PM

William Klosowski

I read it with CPtool..

Jan 30, 2021, 12:19 PM

Bryan Fields

so 0-3FFF, no?

Jan 30, 2021, 12:18 PM

Bryan Fields

it's a 16k eeprom

Jan 30, 2021, 12:18 PM

Bryan Fields

then read the entire codeplug and back it up

Jan 30, 2021, 12:18 PM

William Klosowski

So it read the radio with no issue

Jan 30, 2021, 12:17 PM

William Klosowski

Ugh

Jan 30, 2021, 12:16 PM

and is 2 bytes. It's the 0000-9999 numeric password add

Waris Tuning and FDB CP Map

	4	5	6	7	8	9
--	---	---	---	---	---	---

Tuning Data

NTS Codeplug Tool for Waris Radios

Read Radio

COM1

Program Radio

Start Address

h00000000

Stop Address

h000003FF

Save File

Read File

M25SHF9DP5A

001TEE0440

9

Unused

lock. Typically unused

MCB (reserved)

William Klosowski

This is XP.

Jan 30, 2021, 12:16 PM

Bryan Fields

<https://www.cnet.com/how-to/7-ways-you-can-take-screenshots-in-windows-10/>

Jan 30, 2021, 12:15 PM

William Klosowski

You just help me get it working??

Jan 30, 2021, 12:15 PM

Bryan Fields

when the cdm begins to shine, like will's had to much wine, that's a Moiré

Jan 30, 2021, 12:14 PM

William Klosowski

Ok now what would you put in here.

Jan 30, 2021, 12:13 PM

William Klosowski

Oh ok

Jan 30, 2021, 11:55 AM

Bryan Fields

well i mean, only if you want to program the passport board

Jan 30, 2021, 11:55 AM

Bryan Fields

no

Jan 30, 2021, 11:54 AM

William Klosowski



Jan 30, 2021, 11:54 AM

William Klosowski

Does it require Passport CPS due to it has a Passport system in it?

Jan 30, 2021, 11:54 AM

Bryan Fields

sounds like you're gonna need some of this



🤔 Alex Elmi

Jan 30, 2021, 11:52 AM

Alex Elmi

It's gonna be something hopping between the islands doing an Astro core upgrade

Jan 30, 2021, 11:51 AM

Bryan Fields

I'm in st pete

Jan 30, 2021, 11:39 AM

Alex Elmi

Anywhere near Orlando?

Jan 30, 2021, 11:39 AM

Bryan Fields

well you can bring it by, and I'll fire up the hot air

Jan 30, 2021, 11:36 AM

Alex Elmi

Well I mean it's not necessarily a ham thing so I didn't want to assume lol - more like a side project that I just need to button up before I move

Jan 30, 2021, 11:36 AM

Bryan Fields

er, wont

Jan 30, 2021, 11:35 AM

Bryan Fields

I don't charge

Jan 30, 2021, 11:34 AM

Bryan Fields

https://wiki.w9cr.net/index.php/W9CR:About#I_help_hams

Jan 30, 2021, 11:34 AM

Alex Elmi

@Bryan Fields how much would you charge for a quick channel switch swap on an XTS2500? No hot air station here right now and I want this fucker reassembled and gone lol

Jan 30, 2021, 11:32 AM

William Klosowski

Lol I just need it fixed.

Jan 30, 2021, 10:32 AM

Bryan Fields

ok, i'll give you 50 for it when you brick it

Jan 30, 2021, 10:31 AM

William Klosowski

403-470

Jan 30, 2021, 10:30 AM

Bryan Fields

what band split is it?

Jan 30, 2021, 10:30 AM

William Klosowski

Ok will do that

Jan 30, 2021, 10:30 AM

Bryan Fields

but back it up first

Jan 30, 2021, 10:29 AM

William Klosowski

Ok

Jan 30, 2021, 10:28 AM

Bryan Fields

write it only starting at 0x280

Jan 30, 2021, 10:26 AM

William Klosowski

Oh ok

Jan 30, 2021, 10:26 AM

Bryan Fields

default codeplug

Jan 30, 2021, 10:25 AM

William Klosowski

So how would I get this working.

Jan 30, 2021, 10:25 AM

William Klosowski

I cant speak for that.

Jan 30, 2021, 10:22 AM

Bryan Fields

well some one was

Jan 30, 2021, 10:21 AM

William Klosowski

It has passport on it as well

Jan 30, 2021, 10:21 AM

William Klosowski

No one it was bought on Ebay.

Jan 30, 2021, 10:21 AM

William Klosowski

That's why I'm seeing what I'm seeing

Jan 30, 2021, 10:21 AM

Bryan Fields

who was fucking around with your radio?

Jan 30, 2021, 10:21 AM

Bryan Fields

if it can't unpack it

Jan 30, 2021, 10:20 AM

Bryan Fields

it will fail

Jan 30, 2021, 10:20 AM

Bryan Fields

then convert it to the .srec format that cps uses and try opening that

Jan 30, 2021, 10:20 AM

Bryan Fields

if you want to be sure, you can use cp tool to read the radio

Jan 30, 2021, 10:20 AM

Bryan Fields

that error is CPS failing to unpack the radio codeplug

Jan 30, 2021, 10:19 AM

Bryan Fields

go back and read what i said, but pay attention this time

Jan 30, 2021, 10:19 AM

William Klosowski

Also now I have a XP machine with serial port and now its saying Can not create unknown radio component.

Jan 30, 2021, 10:02 AM

William Klosowski

Lol damn..

Jan 30, 2021, 10:01 AM



😬 Austin Read
😬 Ryan James Haynie

Jan 30, 2021, 1:10 AM

Bryan Fields

🎵 When Will takes a low effort pic, thats a Moiré! 🎵

😏 Austin Read

Jan 29, 2021, 10:16 PM

Bryan Fields

Thanks for that low effort vertical camera phone picture.

♥ Ryan Owens

Jan 29, 2021, 10:14 PM

Bryan Fields

But in this case, it looks like you're reading the radio fine and cps is shiting the bed

Jan 29, 2021, 10:13 PM

Bryan Fields

Works fine

Jan 29, 2021, 10:12 PM

Bryan Fields

I program radios from a win7vm on osx

Jan 29, 2021, 10:12 PM

Bryan Fields


Or like you can use the right prolific driver

Jan 29, 2021, 10:12 PM

William Klosowski

Guessing I just need a laptop with a true serial port.

Jan 29, 2021, 8:20 PM

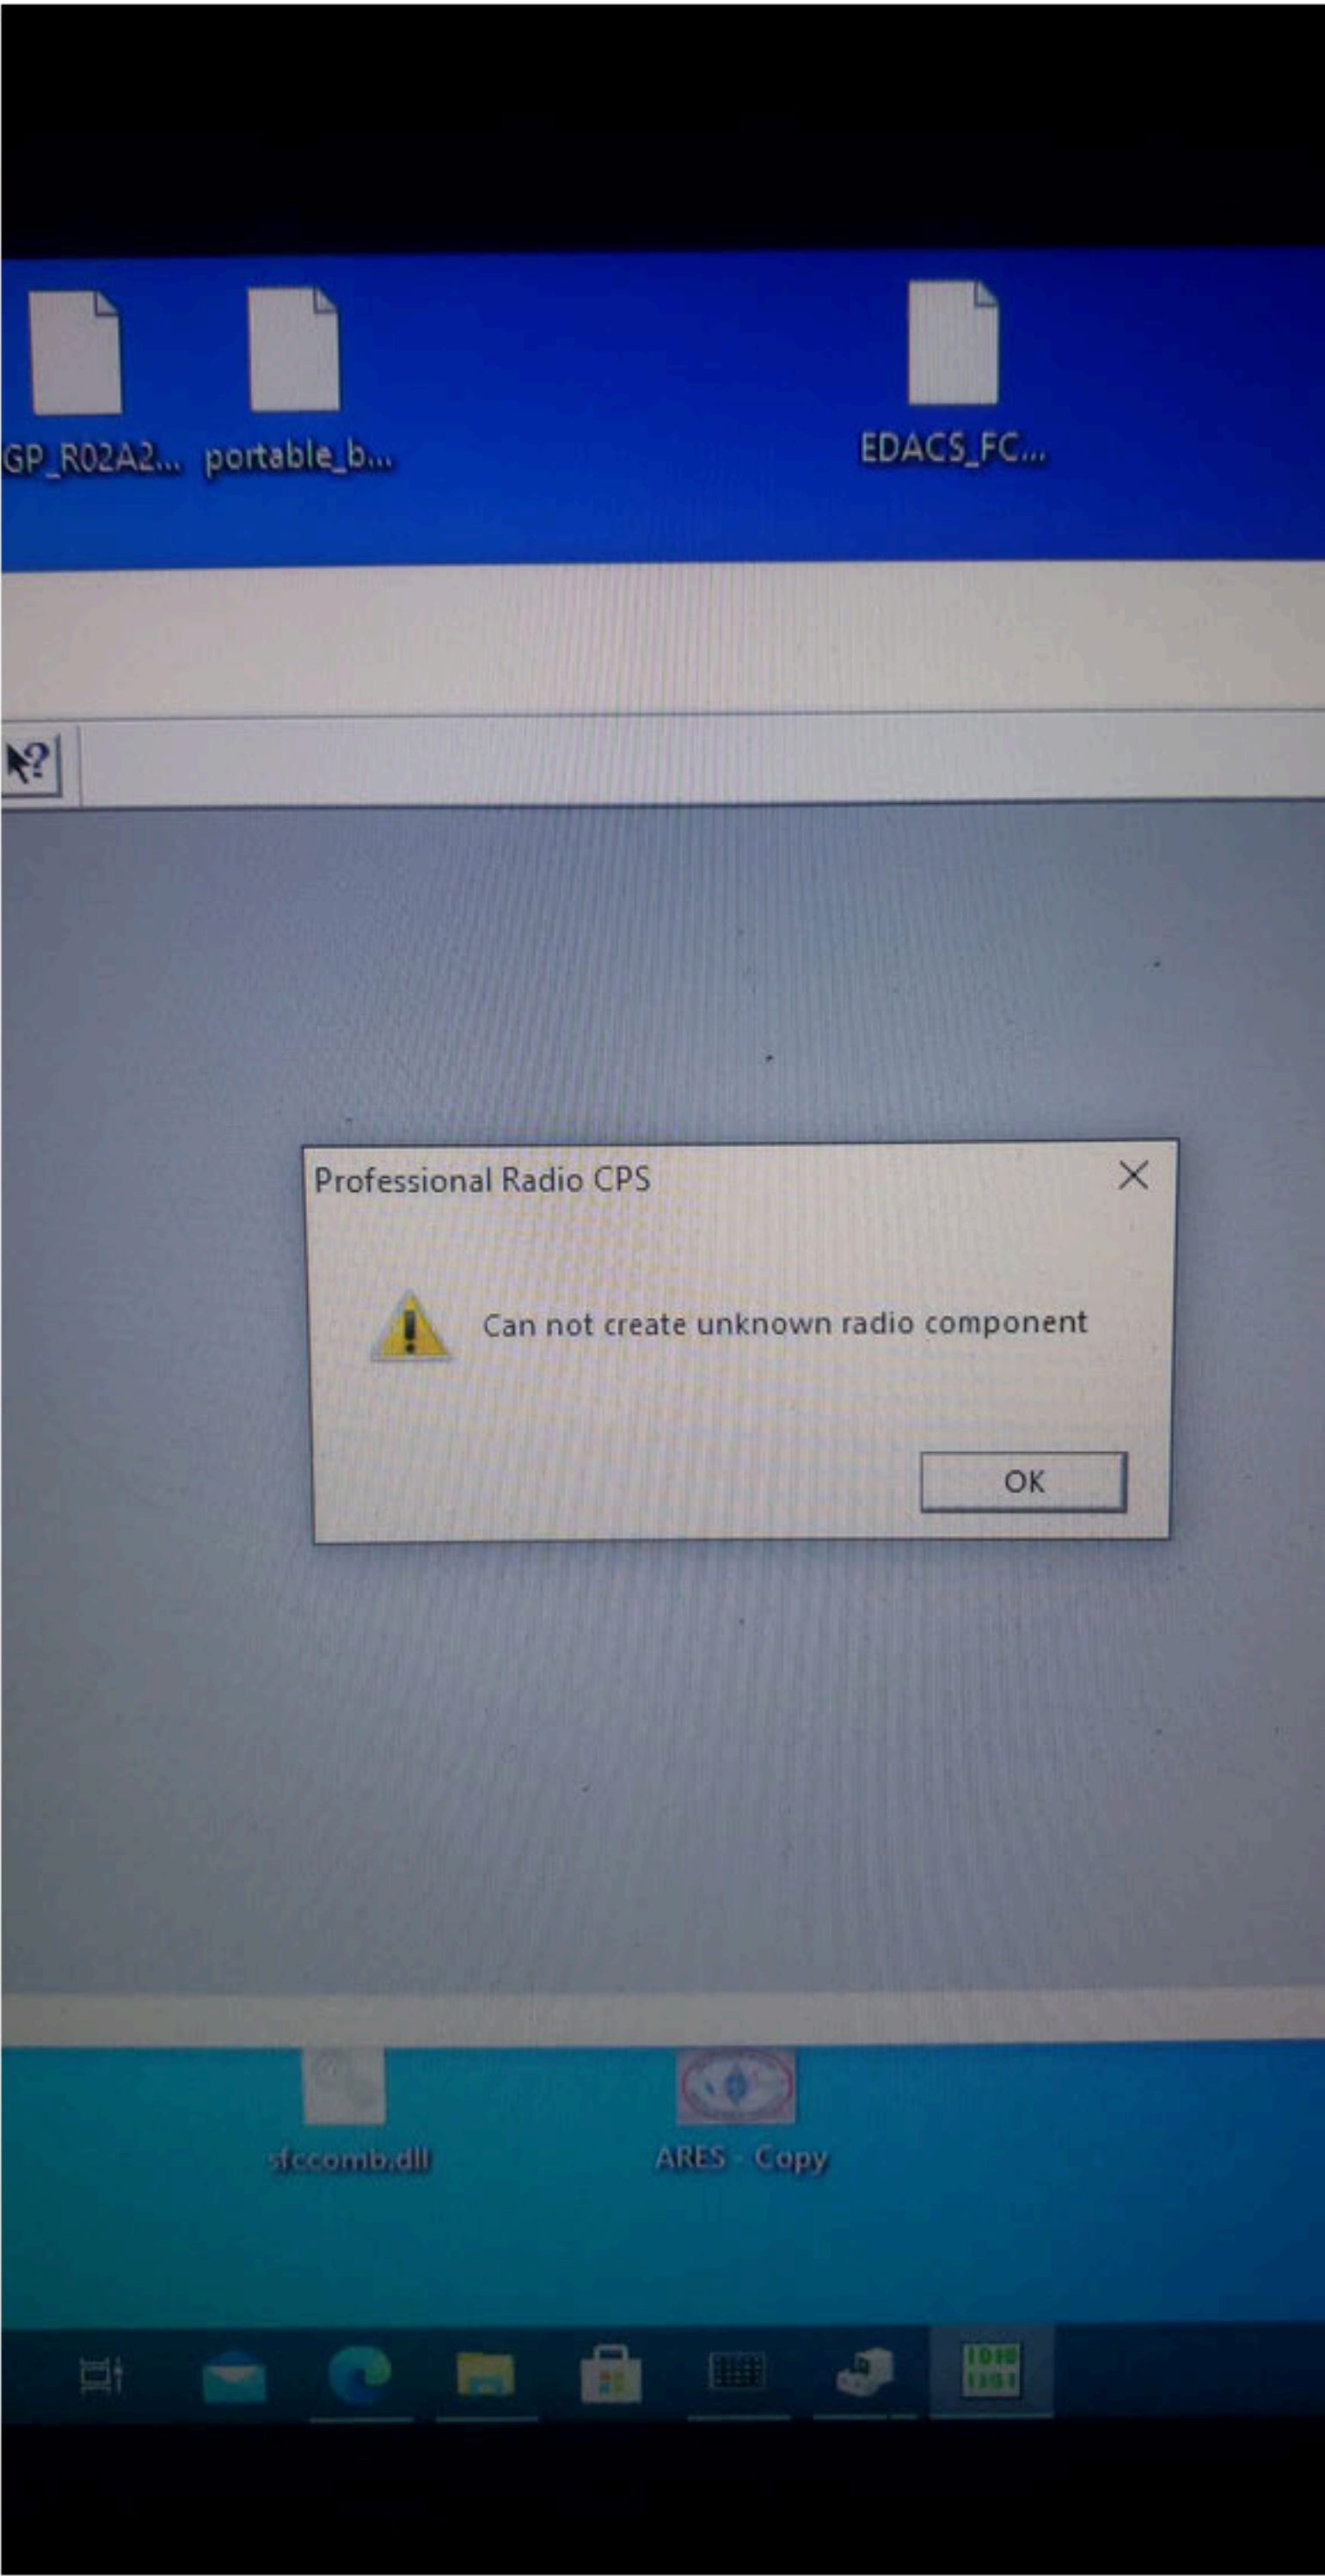

Bryan Fields

PL chipset will work, but needs a specific revision of the driver.

Jan 29, 2021, 7:59 PM

Bryan Fields

sucks

Jan 29, 2021, 7:58 PM

William Klosowski

I think I got the wrong cable..

Jan 29, 2021, 7:58 PM

Bryan Fields

you want to use the PL chipset with the FTDI driver?

Jan 29, 2021, 7:57 PM

William Klosowski

Can I change the driver?

Jan 29, 2021, 7:57 PM

Bryan Fields

get an FTDI based one. Prolific blows chode

Jan 29, 2021, 7:56 PM

William Klosowski

Ugh.

Jan 29, 2021, 5:49 PM

William Klosowski

@Bryan Fields the CDM1550 hates me..wont let me read it..usb to serial and cant change the com port

Jan 29, 2021, 5:47 PM

William Klosowski

It's back...

Jan 29, 2021, 4:41 PM

William Klosowski

Yeah

Jan 29, 2021, 4:00 PM

Bryan Fields

you STFW'd, eh?

Jan 29, 2021, 4:00 PM

William Klosowski

Such a GD idiot...your site.

Jan 29, 2021, 3:59 PM

William Klosowski

But can you get the software to me please?

Jan 29, 2021, 3:56 PM

Bryan Fields

😂 see, I'm helping you

Jan 29, 2021, 3:55 PM

William Klosowski

Lol wow

Jan 29, 2021, 3:55 PM

Bryan Fields

Is that why your wife is doing other guys?

Jan 29, 2021, 3:54 PM

William Klosowski

I mean I had it at one point just dont know where it went.

Jan 29, 2021, 3:54 PM

Bryan Fields

Yes

Jan 29, 2021, 3:53 PM

William Klosowski

Making jokes can you help me?

Jan 29, 2021, 3:52 PM

Bryan Fields

STFW

Jan 29, 2021, 3:51 PM

William Klosowski

?

Jan 29, 2021, 3:51 PM

Bob Cheeks Fuhrmeister

Lol

Jan 29, 2021, 3:51 PM

Bryan Fields

God damn it Will

😞 Austin Read

😞 Ryan Owens

Jan 29, 2021, 3:51 PM

William Klosowski

Anyone have Professional CPS for a CDM1550ls?

Jan 29, 2021, 3:50 PM